

Part Number Update

Bulletin No: PNU-186

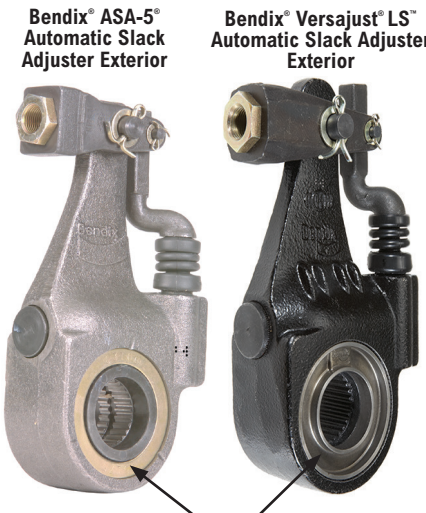
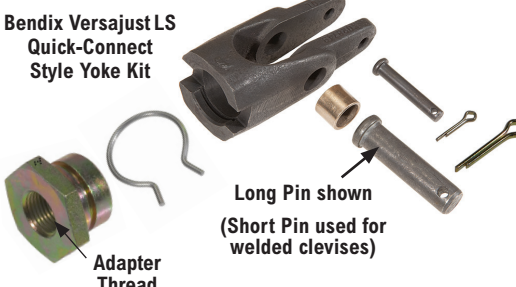
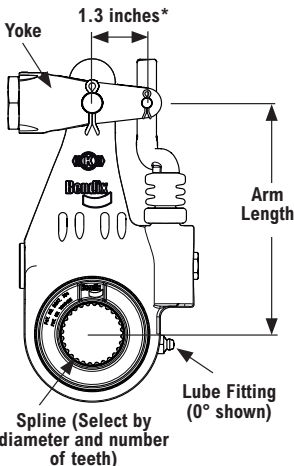

Effective Date: January 13, 2014 Cancels: NA

Page: 1 of 2

Subject: Bendix® Slack Adjuster OEM Replacement Part Numbers Announced

Bendix announces that OEM Bendix® ASA-5® slack adjusters are being obsoleted and will remain active and saleable only while supplies last. Once the inventory is depleted, all orders placed will be filled by the equivalent Bendix® Versajust® LS™ Slack Adjuster with the WearMax™ Clutch. This Bulletin shows the OEM Bendix Versajust LS slack adjuster part number replacements, as well some new OEM Bendix Versajust LS slack adjuster units for use with welded clevis chambers. Please use the new part numbers for future orders.

See *Part Number Update PNU-184* for service replacement part numbers.

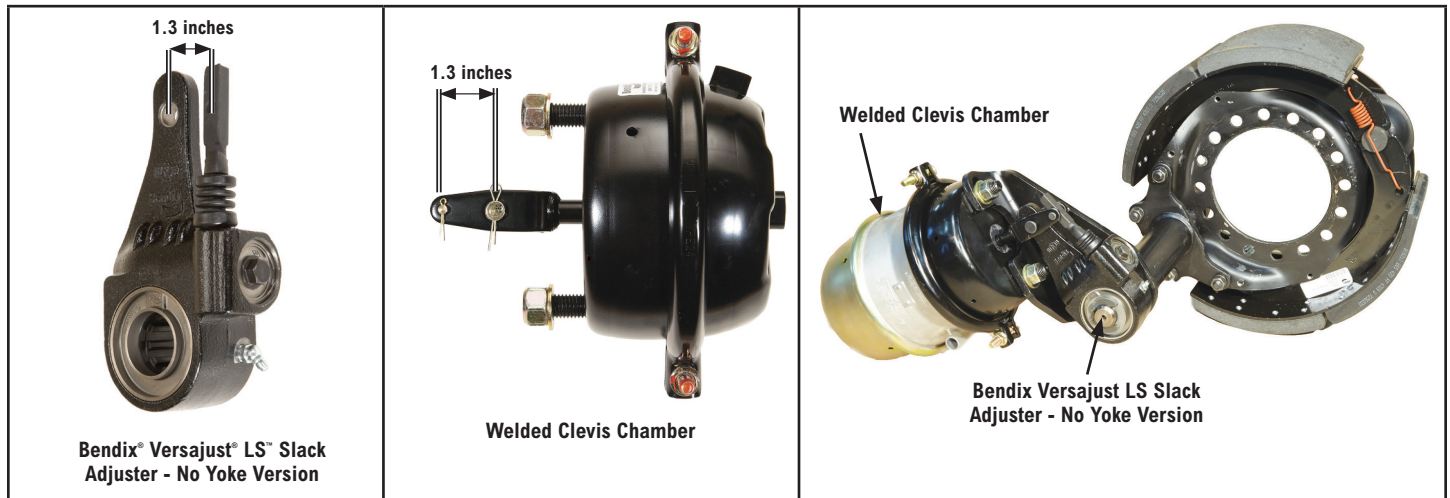
| | | |
|---|--|---|
|  <p>Bendix® ASA-5® Automatic Slack Adjuster Exterior</p> <p>Bendix® Versajust® LS™ Automatic Slack Adjuster Exterior</p> <p>Part Number Etched Here</p> | <p>Bendix Versajust LS Quick-Connect Style Yoke Kit</p>  <p>Adapter Thread</p> <p>Long Pin shown (Short Pin used for welded clevises)</p> |  <p>Yoke 1.3 inches*</p> <p>Arm Length</p> <p>Lube Fitting (0° shown)</p> <p>Spline (Select by diameter and number of teeth)</p> <p>*Note: Pin Centers are 1.3 inches apart for Versajust LS Slack Adjusters - for ASA-5 Slack Adjusters the distance is 1 inch.</p> |
| <p>Bendix Versajust LS Easy-On Style Yoke</p>  <p>Adapter Thread</p> | | |
| <p>NOTE: ASA-5 and Versajust LS Slack Adjuster YOKES are NOT INTERCHANGEABLE.</p> | | |

Section A — OE Slack Adjusters WITH Yokes: Bendix® ASA-5® to Bendix® Versajust® LS™ slack adjuster equivalents.

| Arm Length | Camshaft Spline (Dia.- Teeth) | Adapter Thread | Yoke Style | Lube Fitting | Obsolete Bendix® ASA-5® Slack Adjuster OE Part No. | Order Bendix® Versajust® LS™ Slack Adjuster OE Part No. |
|------------|-------------------------------|----------------|---------------|--------------|--|---|
| 5.0" | 1.25" - 24 | None | Quick Connect | 0° | 5016843 | K102358 |
| 5.5" | 1.50" - 10 | 5/8" | Quick Connect | 0° | 106195 | K043123 |
| | | | | | 107105 | K047176 |
| | 1.50" - 28 | 5/8" | Easy On | 90° | K020298 | |
| | | | | | 108068 | |
| | | | Quick Connect | 0° | 108371 | |
| | | | | | 5015679 | |
| 6.0" | 1.50" - 10 | 5/8" | Easy On | 90° | 106204 | K031529 |
| | | 5/8" | Quick Connect | 90° | 108645 | K102361 |
| | 1.50" - 28 | 5/8" | Easy On | 0° | 108092 | K041874 |
| | | | | | 106194 | K043085 |
| | | | | | 107101 | K047391 |
| | 107127 | | | | | |
| | 1.50" - 28 | 5/8" | Easy On | 45° | K020299 | K047392 |
| | 1.50" - 28 | None | Quick Connect | 90° | 107278 | |
| 1.50" - 28 | 5/8" | Quick Connect | 0° | 108430 | K102364 | |
| | | | | 106201 | K047390 | |
| | | | | 106926 | | |
| 1.63" - 37 | 5/8" | Easy On | 0° | 107102 | K102365 | |

Section B — New Bendix® Versajust® LS™ Slack Adjusters WITHOUT Yokes

These are for use with welded clevis chambers with 1.3 inch pin-to-pin spacing.



New OE Bendix Versajust LS Slack Adjusters WITHOUT Yokes:

| Arm Length | Bendix® Versajust® LS™ OE Part Number | Camshaft Spline (Diameter - Teeth) | Lube Fitting |
|------------|---------------------------------------|------------------------------------|--------------|
| 5.0" | K096191 | 1.25" - 24 | 0° |
| | K096196 | | 45° |
| | K096193 | | 90° |
| | K096194 | 1.50" - 10 | 45° |
| | K096192 | 1.50" - 28 | 0° |
| | K096195 | | 45° |
| 5.5" | K041480 | 1.25" - 10 | 0° |
| | K047163 | | 90° |
| | K047160 | 1.50" - 10 | 0° |
| | K047161 | | 45° |
| | K041479 | | 90° |
| | K046808 | 1.50" - 28 | 0° |
| | K046804 | | 45° |
| K041743 | 90° | | |
| 6.0" | K043149 | 1.50" - 10 | 0° |
| | K047206 | | 45° |
| | K041477 | | 90° |
| | K047204 | 1.50" - 28 | 0° |
| | K047205 | | 45° |
| | K041478 | | 90° |

Reference Document:

The Service Data Sheet for the Bendix® Versajust® LS™ slack adjuster with the WearMax™ Clutch is SD-05-4630. This document is available for download from the Bendix Document Library at www.bendix.com, or may be ordered from the Marketing Center.

For more information contact your Bendix Account Manager or Plant at 1-800-AIR-BRAKE (1-800-247-2725).



Log-on and Learn from the Best
 On-line training that's available when you are —24/7/365.
 Visit www.brake-school.com.